

tempmate.[®]-M2


OPERATION INSTRUCTIONS

 Start Button


 Stop Button

 Green LED


 Red LED

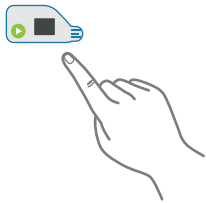

01 Keep green button pressed for minimum 5 seconds to start recording

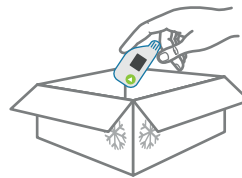

02 Add started tempmate.[®]-M2 to your shipment

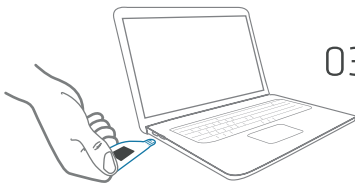


03 Connect stopped logger directly to USB port



04 The PDF report will be generated automatically

 LED Indication
 Display Indication




 Start Logger
 5 sec. Stop Logger

Rec. 
Stop 

 Not started
 1 time Low battery

 3 sec. 

Recording-OK
 Recording-Alarm

Rec.  
Rec. 

Stopped-OK
 Stopped-Alarm

Stop  
Stop 

 Set Mark
 2 times Mark limit full

Mark 
Mark 



For further information visit www.tempmate.com/M2