Laboratory Service PHYSICAL TEST REPORT

Rue de Mons 3 - B-4000 Liège - Belgium Tel.: +32 4 224 71 40 - Fax: +32 4 224 25 90

Member of Schréder Group

Subject: I.S. SKIDO (hand mounted by HUS)

Sample n°: P-E13088

From: HUS

Test purpose: Mechanical impact resistance test following IEC/EN 62262 Standard

Remarks:

Test request n°: P-D13182 Folder n°: P-F13034


TEST CONDITIONS:

I.S. Skido with PC protector Info material not received

At pendulum hammer

5+3 impact points distributed on protector surface One impact on each point

Operator: BOMBIL Patrick

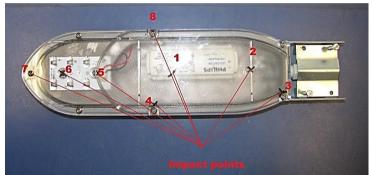

Test

IK05: Impact energy: 0,7 joules

Hammer weight: 0,2 kg Height of fall: 35 cm

IK06: Impact energy: 1 joule

Hammer weight: 0,5 kg Height of fall: 22 cm

IK07: Impact energy: 2 joule

Hammer weight: 0,5 kg Height of fall: 40 cm

IK08: Impact energy: 5 joules

Hammer weight: 1,7 kg Height of fall: 29,4 cm

Result

OK, nothing to indicate

OK, nothing to indicate

OK, nothing to indicate

OK for the protector, but a deformation of the

alu sheet clamp allows the release of the fitting.

See pictures here after.

CONCLUSIONS:

SKIDO satisfies the IK07 test in accordance with IEC/EN 62262 Standard.

Duplicate to: MM C. Horvath, C. Marville, Y. Borlez

LAB 19/04/2013

J.P. Harchies

P-13E182

P-13E182

I.S. SKIDO (hand made by HUS)

