



RDW

Vehicle Technology Division

THE NETHERLANDS
(N E D E R L A N D)



COMMUNICATION

Concerning ⁽¹⁾:

- approval granted
- ~~approval extended~~
- ~~approval refused~~
- ~~approval withdrawn~~
- ~~production definitely discontinued~~

of a type of pneumatic tyre for motor vehicles pursuant to Regulation number 30.

Approval number: E4-30R-0269526

Extension number: 00

Approval mark:



0269526

1. Manufacturer's name or trade mark(s) : GRIPMAX
on the tyre type
2. Tyre type designation by the manufacturer : STATURE H/T
3. Manufacturer's name and address : SHANDONG JINYU INDUSTRIAL CO., LTD.
Guangrao ETDZ, Dongying City,
Shandong Province, P.R. China
4. If applicable, name and address of the manufacturer's representative : not applicable
5. Summarised description
 - 5.1. Tyre size designation : 235/55R18
 - 5.2. Category of use : normal/snow/temporary use ⁽¹⁾
 - 5.3. Structure : ~~diagonal/bias belted~~/radial
 - 5.4. Speed category symbol : V

P.O. Box 777
2700 AT Zoetermeer
The Netherlands

Tel. + 31 (0)79 345 81 43
Fax + 31 (0)79 345 80 43
www.rdw.nl


Vehicle Approval and Information



Approval number: E4-30R-0269526

Extension number: 00



- 5.5. Load-capacity index : 100
6. Technical service and, where applicable, test laboratory approved for purposes of approval or of verification of conformity : TÜV Rheinland Kraftfahrt GmbH
Technologiezentrum Verkehrssicherheit
Typprüfstelle Fahrzeuge/Fahrzeugteile
Am Grauen Stein
D-51105 Köln (Poll)
7. Date of report issued by that service : July 03, 2013
8. Number of report issued by that service : 86-R30-538/13
9. Reason(s) of extension (if applicable) : not applicable
10. Any remarks : ---
11. Approval : granted/~~extended/refused/withdrawn~~⁽¹⁾
12. Place : Zoetermeer
13. Date : 29-JUL-2013
14. Signature :

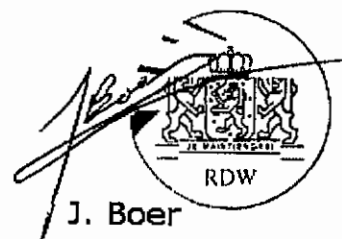
J. Boer


15. The list of documents in the approval file which are deposited at the administrative service having delivered the approval and which can be obtained upon request.

- Application form relating to ECE approval for a pneumatic tyre pursuant to Regulation number 30.
- The drawing of the tyre's sidewalls, tread and dimensioned cross-section.
- The test report as mentioned in item 8.


⁽¹⁾ Strike out what does not apply.

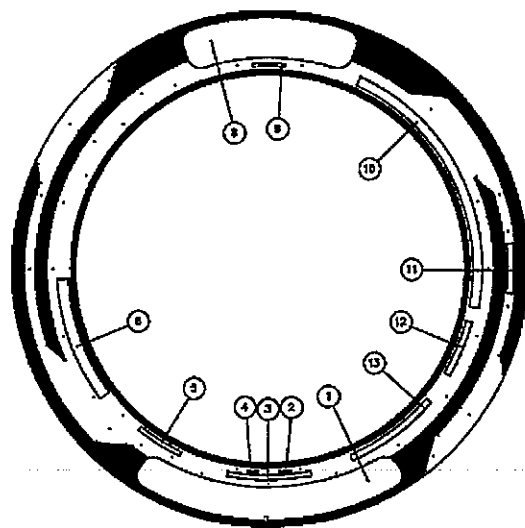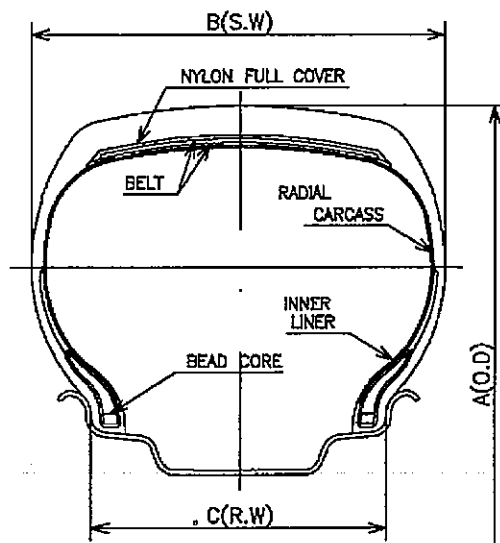

UPPER

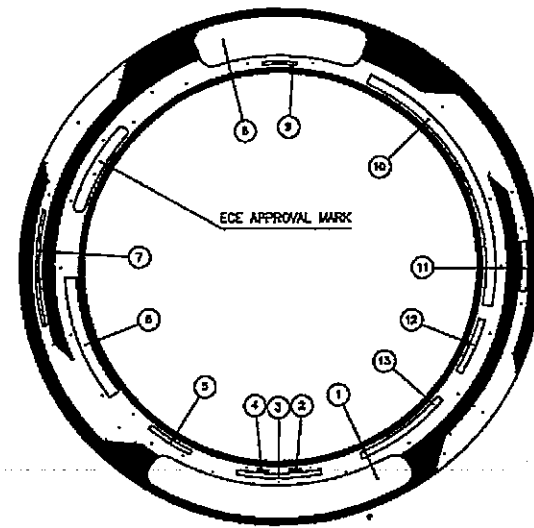

LOWER

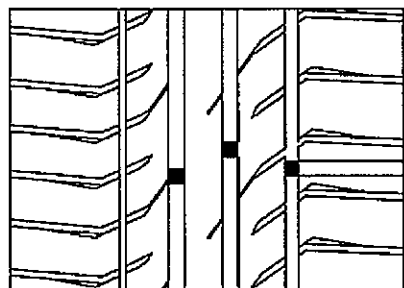


STATURE H/T

TREADWEAR INDICATOR

1	STATURE H/T	9	MADE IN CHINA
2	KEJC	10	SAFETY WARNING
3	RADIAL TUBELESS	11	INSIDE(OUTSIDE)
4	RIM: 7 1/2J	12	MAX. LOAD 800 KG(1764 LBS) MAX.PRESS 300KPA(44PSI)
5	DOT KEJC DXP XXXX (DATE CODE)	13	SIDEWALL PLIES: 2 POLYESTER TREAD PLIES: 2POLYESTER+2STEEL+1NYLON
6	235/55R18 100V		
7	U.T.Q.G		
8	GRIPMAX *		

TIRE SIZE	A(mm)	B(mm)	C(INCH)	LOAD INDEX SPEED CODE	REMARK
235/55R18	715	245	7.5	100 V	

SCALE : FREE	DATE : 13/06/18	DESIGNED BY	DRAWN BY	CHECKED BY	APPROVED BY	DRAWING NO.	E4-JCDX
SHANDONG JINYU INDUSTRIAL CO.,LTD	-	xi yong hong	yang wan long	zhu zuo yong		TITLE	235/55R18 100V

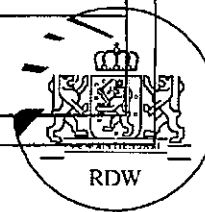

TEST REPORT

According to ECE-Regulation

Uniform provisions concerning the approval of pneumatic tyres for motor vehicles and their trailers

ECE-R30, Amend.02, Suppl. 17

Approval Status

Previously granted
ECE type – approval : ---

Structure of report:

Item No.	
1.	General information
2.	Test object
3.	Test record
4.	List of Appendices
5.	Statement of conformity
Appendix 0	List of modifications

The Test Report shall be reproduced and published in full by the client only. It shall however be reproduced partially with the written permission of the Testing Laboratory only.



Manufacturer : SHANDONG JINYU INDUSTRIAL CO., LTD.
Type : 235/55R18

**1. General information**

- 1.1. Manufacturer's name and address : SHANDONG JINYU INDUSTRIAL CO., LTD.
Guangao ETDZ, Dongying City,
Shandong Province, P.R. China
- 1.2. Technical service responsible for carrying out the tests : TÜV Rheinland Kraftfahrt GmbH
Technologiezentrum Verkehrssicherheit
Typprüfstelle Fahrzeuge/Fahrzeugteile
Am Grauen Stein
D-51105 Köln (Poll)
- 1.3. Type : 235/55R18
- 1.4. Trade mark(s) : GRIPMAX
- 1.5. Tread pattern name(s) : STATURE H/T
- 1.6. No. of the information folder : ---
 - Date of issue : ---
 - Date of last change : ---

2. Test object

- 2.1. Markings
- 2.1.1. Trade mark : GRIPMAX
- 2.1.2. Tread pattern name : STATURE H/T
- 2.1.3. Plies
- Tread : 2 POLYESTER + 2 STEEL + 1 NYLON
- Side wall : 2 POLYESTER
- 2.1.4. Size designation : 235/55R18
- 2.1.5. Special protective band : no
- 2.1.6. Category of use : normal
- 2.1.6. Structure : radial
- 2.1.7. Speed category : V
- 2.1.8. Load-Capacity Indices : 100
- 2.1.9. Ply-rating number for diagonal (bias-ply) tyres : ---
- 2.1.10. Indication 1 : tubeless
- 2.1.11. Indication 2 : not reinforced
- 2.1.12. Date of manufacture : 1913
- 2.1.13. Identification number : ---



Manufacturer : SHANDONG JINYU INDUSTRIAL CO., LTD.
 Type : 235/55R18



2.2 Remarks

: all versions of the types as stated in the information document are covered with the tested test object respectively.

3. Test record

3.1. Equipment for measuring and testing

: The test facilities / measurement equipment used were in compliance with the test requirements.

3.2. Test results

Remark concerning extension

: n.a.

~~[The type has been tested according to the modification(s) mentioned in item Appendix 0.]~~

~~[The results of previous test are still valid.]~~

3.2.1. Dimension Measurement according to Annex 6

3.2.1.1 Measuring rim

: 7.0J x 18

3.2.1.2 Inflation pressure (after mounting 3 to 3.5 bar)

: 3.0 bar

3.2.1.3 Inflation pressure (readjusted before conditioning)

: 1.8 bar

3.2.1.4 Duration of conditioning of mounted tyre pre-measuring at ambient room temperature

: more than 24 hours

3.2.1.5 Inflation pressure (readjusted after conditioning)

: ---

3.2.1.6 Overall width at six equally spaced points

Height of six equally spaced tread wear indicators

1.	241	mm
2.	241	mm
3.	240	mm
4.	241	mm
5.	240	mm
6.	241	mm
Max.:	241	mm

1.	1.74	mm
2.	1.78	mm
3.	1.78	mm
4.	1.76	mm
5.	1.70	mm
6.	1.75	mm

3.2.1.7 Circumference

: 2241 mm

3.2.1.8 Outer diameter

: 713.3 mm

3.2.2 Load/speed performance test according to ANNEX 7

3.2.2.1 Test machine

: SYSB-P-001

3.2.2.2 Diameter test drum

: 1.707 m

3.2.2.3 Test rim

: 7.0J x 18

3.2.2.4 Conditioning of mounted tyre pre-testing at test-room temperature

: more than 3 hours

3.2.2.5 Test-room temperature

: 32°C

3.2.2.6 Inflation pressure (readjusted before conditioning)

: 3.0 bar

3.2.2.7 Inflation pressure (readjusted after conditioning)

: 3.0 bar



Manufacturer : SHANDONG JINYU INDUSTRIAL CO., LTD.
 Type : 235/55R18



3.2.2.8 Circumference after conditioning, before testing : 2241 mm
 3.2.2.9 Outer diameter : 713.3 mm
 3.2.2.10 Inflation pressure : 3.0 bar
 3.2.2.11 Load (80% x 91%) : 584 kg

Step	Step-Duration [min]	Total Duration [min]	Actual speed (km/h)
1.	10	10	0 - 200
2.	10	20	200
3.	10	30	210
4.	10	40	220
5.	20	60	230

3.2.2.12 Conditioning after testing at test-room temperature : more than 6 hours
 3.2.2.13 Inflation pressure : 3.0 bar
 3.2.2.14 Circumference after conditioning, after testing : 2247 mm
 3.2.2.15 Outer diameter : 715.2 mm
 3.2.2.16 Difference outer diameter before and after testing : 1.9 mm
 (max. 3.5 %) : 0.27%

3.3 Additional information

The results of the test refer exclusively to object mentioned under point 2.1 of this report.

Test site : SHANDONG JINYU INDUSTRIAL CO., LTD.
 Guangrao ETDZ, Dongying City,
 Shandong Province, P.R. China

Test date : June 19, 2013

Remark : ---

4 List of Appendices

0 List of modifications

5 Statement of conformity

The information folder and the type described there comply with the requirements mentioned in page 1.

The test laboratory is accredited for the above mentioned tests by the accreditation body of the RDW, Vehicle Technology and Information Centre, as the competent Administrative Department for the Netherlands; Designation: RDW-99050014-06.

Engineering Center Guangdong, July 03, 2013
 LX

Dipl.-Ing. Liu Xin



List of modifications

Appendix 0

Correction of : ---

Modification of : ---

Addition of : ---

Deletion of : ---

