

PRZEDSIĘBIORSTWO USŁUGOWO REMONTOWE
REMODEX
ZAKŁAD BADAŃ I WDROŻEŃ PRZEMYSŁU MEBLARSKIEGO
Spółka z o.o.

Garby, ul. Transportowa 1
62-020 Swarzędz

e-mail: biuro@remodex.com.pl
KRS 0000099068

tel./fax. 061 817-22-77
tel. kom. 601 391 825

SIGN: BW/JK/261/2007

DATE: 14.09.2007

Order from: 2007-07-10

TEST REPORT No: 169/07/W

Safety requirements, strength and durability

1. *Name and type of article -*

Cinema chair OSCAR

2. *CLIENT -*

NOWY STYL Sp. z o.o.
ul. Pużaka 49
38-400 KROSNO

3. *Documents identifying article -*

order + technical records.

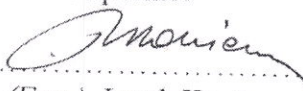
This article was tested in accordance
with the test procedures described in:

PN-EN 12727:2004

TEST RESULTS:

POSITIVE

Test operator


M Sc. (Eng.) Jacek Konieczny

PREZES ZARZĄDU


mgr inż. Piotr Błaszczak



TEST REPORT contain 2 pages

The test results are only valid for the article tested.

This TEST REPORT shall not be reproduced, except in full, without the written approval of the laboratory.

TEST REPORT No: 169/07/W

RANKED SEATING

Name and type of article – Cinema chair OSCAR

Test level: 4

Test unit	Article PN-EN	Test Description	Force (N), height H (mm)	Cycles	Requirement	Test results
Seat	6.3	static load	2000	10	WITHOUT DEFECTS	pass
	6.8	durability test	950	200.000		pass
	6.9	durability test of front edge	950	200.000		pass
	6.11	impact test	H = 300	10		pass
	6.14	drop seat – working test	-	100.000		pass
Back	6.3	static load	760	10		pass
	6.4	static load – horizontal force to front	760	10		pass
	6.5	downwards static load	900	10		pass
	6.8	durability test to back	330	200.000		pass
	6.10	durability test to front	330	100.000		pass
	6.12	impact test	H = 620	10		pass
Arm	6.6	sideways static load	1000	10		pass
	6.7	downwards static load	1000	10		pass
	6.13	impact test	H = 620	10		pass
Auxiliary writing surface	6.15	downwards static load	300	10		---
	6.16	durability test	150	25.000		---

SIGNED
LABORATORIUM